Your PTC may be yellow, green, or two green ones.
Triple check the solder joints on the back of the board that connect this component, the PTC. Partially failed solder joints will allow the screen to come on, but prevent the motor from engaging. Fully failed solder joints will prevent the screen from coming on.

Make sure everything is plugged in correctly

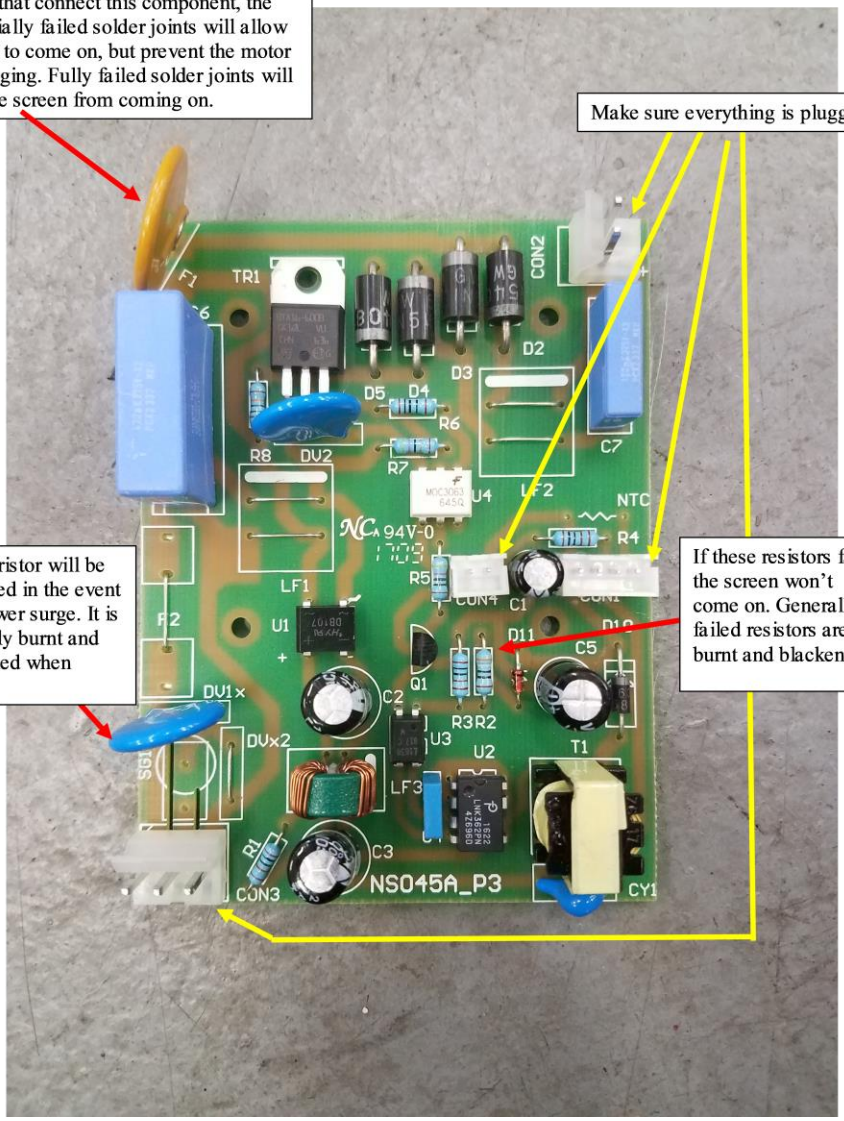

This varistor will be destroyed in the event of a power surge. It is generally burnt and blackened when failed

If these resistors fail, the screen won't come on. Generally failed resistors are burnt and blackened.